Testpassport 問題集

更に上のクオリティ　更に上のサービス

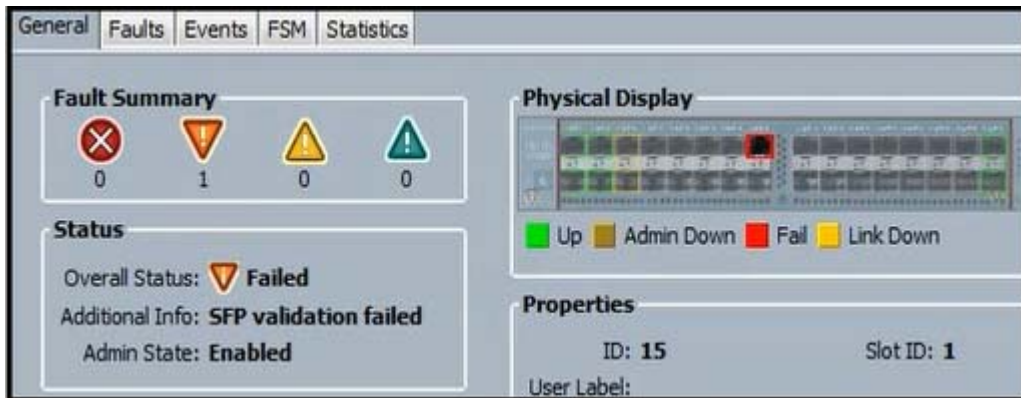**Exam** : **300-615**

Title : Troubleshooting Cisco Data Center Infrastructure (DCIT)

Version : DEMO

1.Refer to the exhibit.

When an engineer inserts 8-Gb Fibre Channel SFP port 15 on a Cisco UCS Fabric Interconnect, the port fails.

What is causing this issue?

A. The polarity of the fiber cable is reversed.

B. Port 15 is configured as an Ethernet port.

C. Port 15 is configured for 4-Gb Fibre Channel.

D. Port 15 is missing a slicense.

Answer: B

2.An engineer must place a Cisco UCS B-Series Server in a single server pool in Cisco UCS Manager. The engineer creates a qualification policy, but the server is still seen in multiple pools.

Which two actions resolve the issue? (Choose two.)

A. Set the operating system qualifier side the Server Pool Policy Qualification.

B. Set the number of vNICs qualifier inside the Server Pool Policy.

C. Set the storage capacity qualifier inside the Server Pool Policy Qualification.

D. Select the Server Pool Policy from the qualification drop-down menu in the Server Pool Policy Qualification.

E. Select the Server Pool Policy Qualification from the qualification drop-down menu in the Server Pool Policy.

Answer:AE

3.Refer to the exhibit.
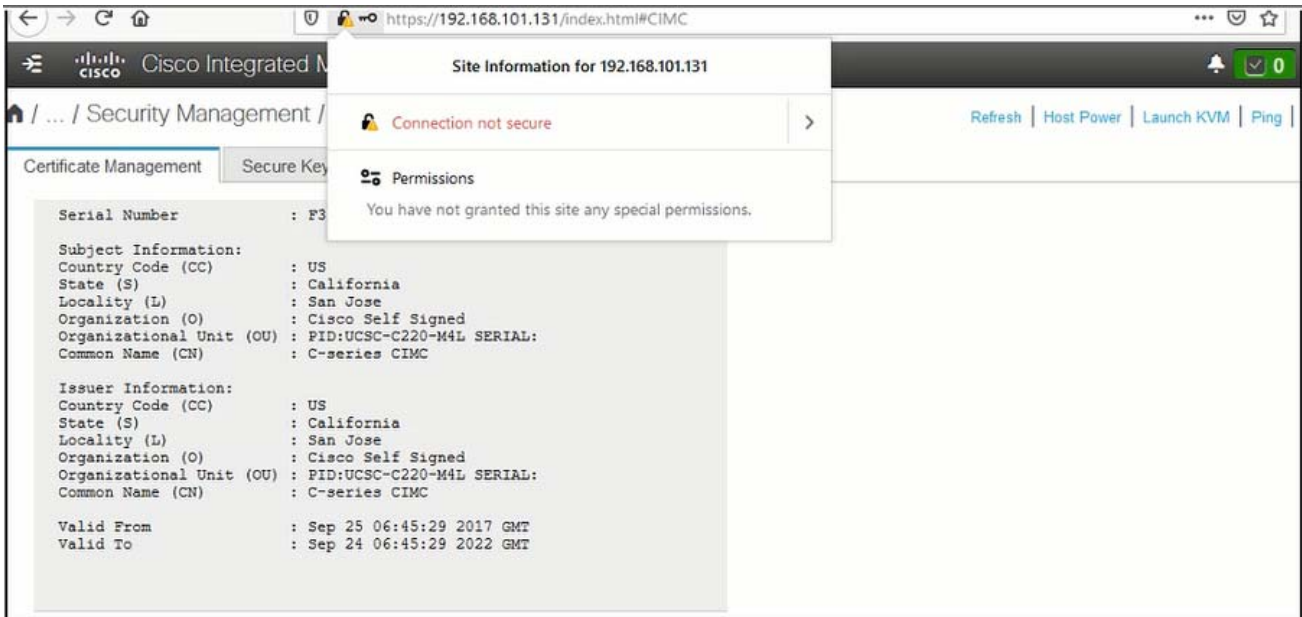
An engineer cannot log in to the Cisco IMC page of the Cisco UCS C220 server.

Which action resolves the issue?

A. Replace the self-signed certificate that is installed on the Cisco IMC with a server certificate that is signed from the client corporate certificate "authority.

B. Replace the self-signed certificate that is installed on the Cisco IMC with a user certificate that is signed from the client corporate certificate authority.

C. Use the DNS of the Cisco IMC webpage login page instead of the IP address for the connection to be secure.

D. Use the FQDN of the Cisco IMC webpage login page instead of the IP address for the connection to be secure.

Answer: A

4.A Cisco UCS B-Series Blade Server is configured to boot a VMware ESXi host from an EMC VNX storage array by using a Fibre Channel SAN. The boot order is confirmed to be configured as expected, but the server fails to boot from the SAN.

Which action resolves the problem?

A. Set the same WWNN pools for vHBA adapters.

B. Set the boot LUN to the highest LUN ID in the storage array.

C. Set the same WWPN pools for vHBA adapters.

D. Set the boot LUN to the lowest LUN ID in the storage array.

Answer: C

5.An engineer troubleshoots a custom AV pair that a client created on an external authentication server to map a read-only role for a specific security domain.

Which Z pair solves the problem?

A. shell=Security_Domain_1/Read_Role_1|Read_Role_2

B. shell:domains=Security_Domain_1//Read_Role_1|Read_Role_2

C. shell:domains=Security_Domain_1/Read_Role_1|Read_Role_2

D. shell:domains=Security_Domain_1/Write_Role_1|Read_Role_2

Answer: B

Answer: B